



Your Inspection Report

76 Pearson Avenue
Toronto, ON M6R 1G5

PREPARED FOR:

KIM KEHOE
LISTING AGENT

INSPECTION DATE:

Thursday, October 23, 2025

PREPARED BY:

Scott Aitken

Aitken Home Inspections
49 Riverdale Ave
TORONTO, ON M4K 1C2

4164074663
scottaitken@live.ca

October 27, 2025

Dear Kim Kehoe and Listing Agent,

RE: Report No. 4385, v.3
76 Pearson Avenue
Toronto, ON
M6R 1G5

Thanks very much for choosing us to perform your home inspection. The inspection itself and the attached report comply with the requirements of the Standards of Practice of our national Association. This document defines the scope of a home inspection.

Clients sometimes assume that a home inspection will include many things that are beyond the scope. We encourage you to read the Standards of Practice so that you clearly understand what things are included in the home inspection and report.

The report has been prepared for the exclusive use of our client. No use by third parties is intended. We will not be responsible to any parties for the contents of the report, other than the party named herein .

The report is effectively a snapshot of the house, recording the conditions on a given date and time. Home inspectors cannot predict future behavior, and as such, we cannot be responsible for things that occur after the inspection. If conditions change, we are available to revisit the property and update our report.

The report itself is copyrighted, and may not be used in whole or in part without our express written permission.

Again, thanks very much for choosing us to perform your home inspection.

Sincerely,

Scott Aitken
on behalf of
Aitken Home Inspections

Aitken Home Inspections
49 Riverdale Ave
TORONTO, ON M4K 1C2
4164074663

scottaitken@live.ca

AGREEMENT

Report No. 4385, v.3

76 Pearson Avenue, Toronto, ON October 23, 2025

PARTIES TO THE AGREEMENT

Company

Aitken Home Inspections
49 Riverdale Ave
TORONTO, ON M4K 1C2

Client

Kim Kehoe

Client

Listing Agent

This is an agreement between Kim Kehoe, Listing Agent and Aitken Home Inspections.

THIS CONTRACT LIMITS THE LIABILITY OF THE HOME INSPECTION COMPANY.
PLEASE READ CAREFULLY BEFORE SIGNING.

In addition to the limitations in the Standards of Practice, the Inspection of this property is subject to the Limitations and Conditions set out in this Agreement. The Inspection is performed in accordance with the Standards of Practice of our national association.

LIMITATIONS AND CONDITIONS OF THE HOME INSPECTION

There are limitations to the scope of this Inspection. It provides a general overview of the more obvious repairs that may be needed. It is not intended to be an exhaustive list. The ultimate decision of what to repair or replace is yours. One homeowner may decide that certain conditions require repair or replacement, while another will not.

1) THE INSPECTION IS NOT TECHNICALLY EXHAUSTIVE.

The Home Inspection provides you with a basic overview of the condition of the property. Because your Home Inspector has only a limited amount of time to go through the property, the Inspection is not technically exhaustive.

Some conditions noted, such as foundation cracks or other signs of settling in a house, may either be cosmetic or may indicate a potential problem that is beyond the scope of the Home Inspection.

If you are concerned about any conditions noted in the Home Inspection Report, we strongly recommend that you consult a qualified Licensed Contractor or Consulting Engineer. These professionals can provide a more detailed analysis of any conditions noted in the Report at an additional cost

2) THE INSPECTION IS AN OPINION OF THE PRESENT CONDITION OF THE VISIBLE COMPONENTS.

The Home Inspector's Report is an opinion of the present condition of the property. It is based on a visual examination of the readily accessible features of the building.

A Home Inspection does not include identifying defects that are hidden behind walls, floors or ceilings. This includes wiring, heating, cooling, structure, plumbing and insulation that are hidden or inaccessible.

Some intermittent problems may not be obvious on a Home Inspection because they only happen under certain circumstances. As an example, your Home Inspector may not discover leaks that occur only during certain weather conditions or when a specific tap or appliance is being used in everyday life.

Home Inspectors will not find conditions that may only be visible when storage or furniture is moved. They do not remove wall coverings (including wallpaper) or lift flooring (including carpet) or move storage to look underneath or behind.

3) THE INSPECTION DOES NOT INCLUDE HAZARDOUS MATERIALS.

This includes building materials that are now suspected of posing a risk to health such as phenol-formaldehyde and urea-formaldehyde based insulation, fiberglass insulation and vermiculite insulation. The Inspector does not identify asbestos roofing, siding, wall, ceiling or floor finishes, insulation or fireproofing. We do not look for lead or other toxic metals in such things as pipes, paint or window coverings.

The Inspection does not deal with environmental hazards such as the past use of insecticides, fungicides, herbicides or pesticides. The Home Inspector does not look for, or comment on, the past use of chemical termite treatments in or around the property.

4) WE DO NOT COMMENT ON THE QUALITY OF AIR IN A BUILDING.

The Inspector does not try to determine if there are irritants, pollutants, contaminants, or toxic materials in or around the building.

The Inspection does not include spores, fungus, mold or mildew that may be present. You should note that whenever there is water damage noted in the report, there is a possibility that mold or mildew may be present, unseen behind a wall, floor or ceiling.

If anyone in your home suffers from allergies or heightened sensitivity to quality of air, we strongly recommend that you consult a qualified Environmental Consultant who can test for toxic materials, mold and allergens at additional cost.

5) WE DON'T LOOK FOR BURIED TANKS.

Your Home Inspector does not look for and is not responsible for fuel oil, septic or gasoline tanks that may be buried on the property. If the building had its heating system converted from oil, there will always be the possibility that a tank may remain buried on the property.

If fuel oil or other storage tanks remain on the property, you may be responsible for their removal and the safe disposal of any contaminated soil. If you suspect there is a buried tank, we strongly recommend that you retain a qualified Environmental Consultant to determine whether this is a potential problem.

6) TIME TO INVESTIGATE

We will have no liability for any claim or complaint if conditions have been disturbed, altered, repaired, replaced or otherwise changed before we have had a reasonable period of time to investigate.

7) REPORT IS FOR OUR CLIENT ONLY

The inspection report is for the exclusive use of the client named herein. No use of the information by any other party is intended.

AGREEMENT

76 Pearson Avenue, Toronto, ON October 23, 2025

Report No. 4385, v.3

8) CANCELLATION FEE

If the inspection is cancelled within 24 hours of the appointment time, a cancellation fee of 50% of the inspection fee will apply.

9) NOT A GUARANTEE, WARRANTY OR INSURANCE POLICY.

The inspection is not a guarantee, warranty or an insurance policy with regard to the fitness of the property.

10) LIMIT OF LIABILITY / LIQUIDATED DAMAGES

The liability of the Home Inspector and the Home Inspection Company arising out of this Inspection and Report, for any cause of action whatsoever, whether in contract or in negligence, is limited to a refund of the fees that you have been charged for this inspection.

I, Kim Kehoe (Signature) _____, (Date) _____, have read, understood and accepted the terms of this agreement.

I, Listing Agent (Signature) _____, (Date) _____, have read, understood and accepted the terms of this agreement.

SUMMARY

Report No. 4385, v.3

76 Pearson Avenue, Toronto, ON October 23, 2025

SUMMARY

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

REFERENCE

This Summary outlines potentially significant issues from a cost or safety standpoint. This section is provided as a courtesy and cannot be considered a substitute for reading the entire report. Please read the complete document.

[Priority Maintenance Items](#)

Electrical

RECOMMENDATIONS \ General

Condition: • Property due for complete rewire upon possession.

Location: Throughout

Task: Replace

Time: Immediate

Cost: \$20,000

This concludes the Summary section.

The remainder of the report describes each of the home's systems and also details any recommendations we have for improvements. Limitations that restricted our inspection are included as well.

The suggested time frames for completing recommendations are based on the limited information available during a pre-purchase home inspection. These may have to be adjusted based on the findings of specialists.

[Home Improvement - ballpark costs](#)

ROOFING

Report No. 4385, v.3

76 Pearson Avenue, Toronto, ON October 23, 2025

SUMMARY

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

REFERENCE

Description

The home is considered to face: • South

Sloped roofing material:

- Composition shingles



1.



2.



3.

ROOFING

Report No. 4385, v.3

76 Pearson Avenue, Toronto, ON October 23, 2025

SUMMARY

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION


PLUMBING

INTERIOR

REFERENCE

Flat roofing material:

- [Modified bitumen membrane](#)

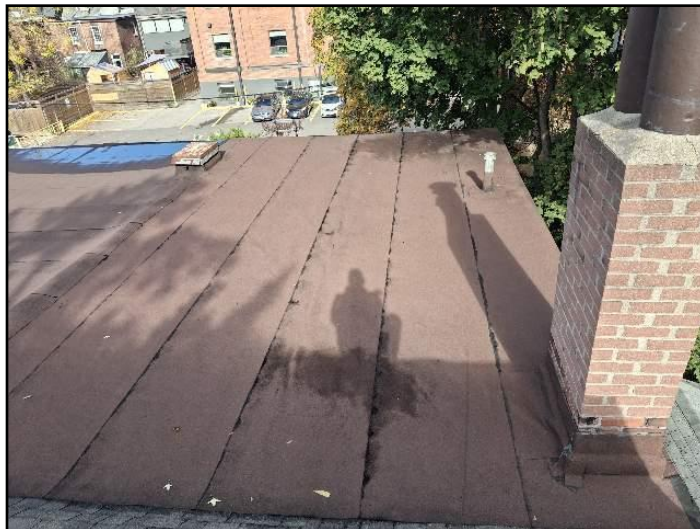

4.

Probability of leakage: • Medium

Recommendations

FLAT ROOFING \ Modified bitumen

1. Condition: • [Openings at seams or flashings](#)

Tune up needed at flat roof.

Implication(s): Chance of water damage to structure, finishes and contents

Task: Repair

Time: Immediate

Cost: Minor

ROOFING

Report No. 4385, v.3

76 Pearson Avenue, Toronto, ON October 23, 2025

SUMMARY

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION


PLUMBING

INTERIOR

REFERENCE



5.

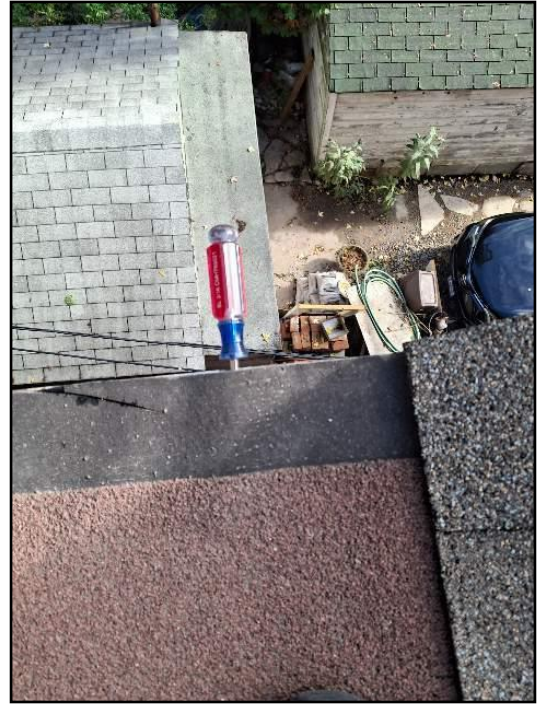

6.



7.

EXTERIOR

Report No. 4385, v.3

76 Pearson Avenue, Toronto, ON October 23, 2025

SUMMARY

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

REFERENCE

Description

Gutter & downspout material: • [Aluminum](#)

Downspout discharge: • [Above grade](#)

Lot slope: • [Flat](#)

Soffit (underside of eaves) and fascia (front edge of eaves): • [Aluminum](#)

Wall surfaces and trim: • [Brick](#)

Retaining wall: • [Masonry](#)

Walkway: • Concrete

Porch: • Concrete • Wood • Brick

Recommendations

WALLS \ Masonry (brick, stone) and concrete

2. Condition: • [Masonry deterioration](#)

Typical tuckpointing or parging needed.


Implication(s): Weakened structure | Chance of structural movement

Location: Various Exterior Wall

Task: Repair

Time: Regular maintenance

Cost: Minor

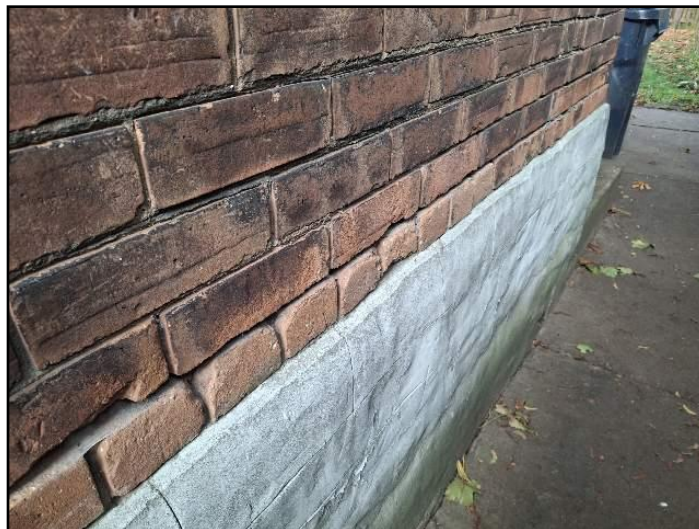

8.

PORCHES, DECKS, STAIRS, PATIOS AND BALCONIES \ General notes

3. Condition: • Disrepair

Front porch primarily original and will require eventual rebuild.

Implication(s): Weakened structure

Location: South Exterior

EXTERIOR

Report No. 4385, v.3

76 Pearson Avenue, Toronto, ON October 23, 2025

SUMMARY

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

REFERENCE


Task: Rebuild

Time: Unpredictable

Cost: Consult Contractor For Cost



9.

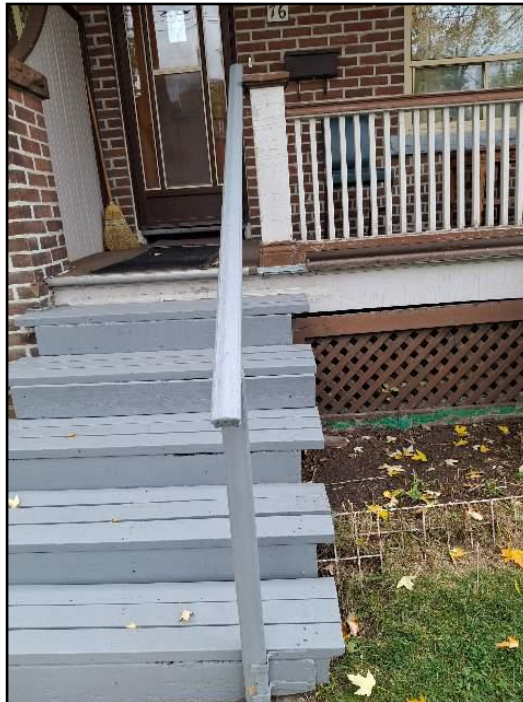

10.

PORCHES, DECKS, STAIRS, PATIOS AND BALCONIES \ Handrails and guards

4. Condition: • [Missing](#)

Implication(s): Fall hazard

Location: North Exterior

Task: Install

Time: Immediate

Cost: Depends on approach

EXTERIOR

Report No. 4385, v.3

76 Pearson Avenue, Toronto, ON October 23, 2025

SUMMARY

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

REFERENCE



11.

LANDSCAPING \ Lot grading

5. Condition: • [Improper slope or drainage](#)

Create drainage away from foundation at north walkway and lawn.

Implication(s): Chance of water damage to structure, finishes and contents

Location: North Exterior

Task: Improve

Time: Unpredictable

Cost: Minor

EXTERIOR

76 Pearson Avenue, Toronto, ON October 23, 2025

Report No. 4385, v.3

SUMMARY

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING


INSULATION

PLUMBING

INTERIOR

REFERENCE

Recommended grading slopes

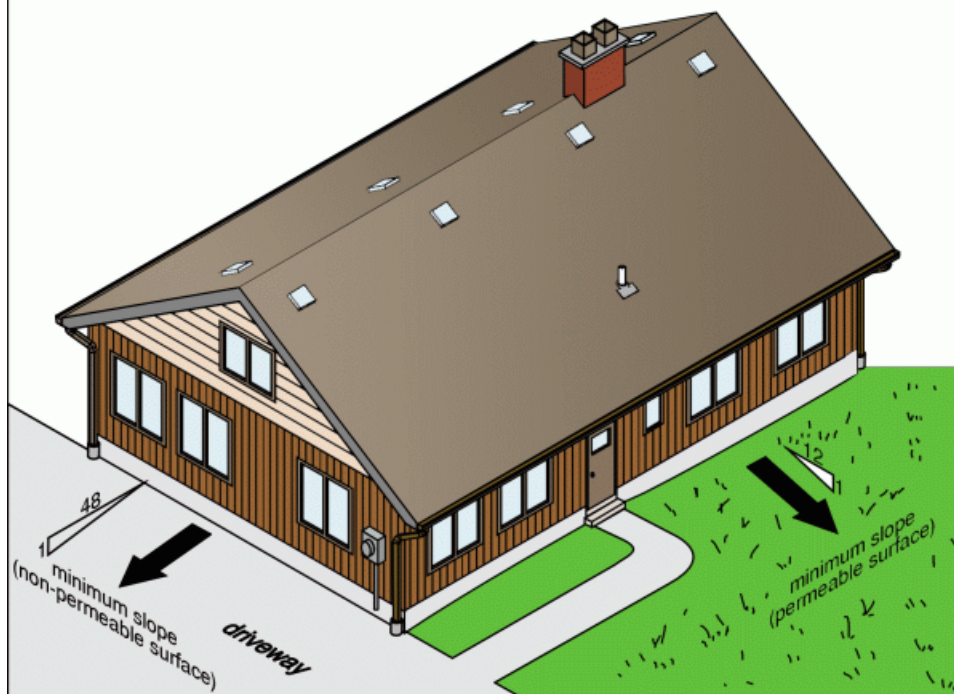

12.

LANDSCAPING \ Fence

6. Condition: • Leaning

Implication(s): Chance of movement | Damage or physical injury due to falling materials

Location: Northeast Exterior

Task: Replace

Time: Immediate

EXTERIOR

76 Pearson Avenue, Toronto, ON October 23, 2025

SUMMARY	ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	COOLING	INSULATION	PLUMBING	INTERIOR
REFERENCE									

Cost: Consult Contractor For Cost



13.

Description

Configuration: • [Basement](#)

Foundation material:

- [Masonry block](#)

At addition only.

- [Stone](#)

Floor construction: • [Joists](#)

Exterior wall construction:

- [Wood frame / Brick veneer](#)

At addition only.

- [Masonry](#)

Roof and ceiling framing: • [Rafters/roof joists](#) • Not visible

Party wall: • [Masonry](#)

Limitations

Attic/roof space:

- No access

Typical with this roofline.

Percent of foundation not visible: • 10 %

Recommendations

WALLS \ Arches

7. Condition: • [Dropped, rotating or leaning](#)

Recommend replacing dining room window arch with steel lintels.

Implication(s): Weakened structure | Chance of structural movement

Location: East Exterior First Floor

Task: Repair or replace

Time: Unpredictable

Cost: Depends on approach



14.

Description

Service entrance cable and location: • [Overhead copper](#)

Service size: • [100 Amps \(240 Volts\)](#)

Main disconnect/service box rating: • [100 Amps](#)

Main disconnect/service box type and location: • [Breakers - basement](#)

System grounding material and type: • [Copper - water pipe](#)

Distribution panel type and location: • [Breakers - basement](#)

Distribution panel rating: • [100 Amps](#)

Distribution wire (conductor) material and type: • [Copper - non-metallic sheathed](#) • [Copper - knob and tube](#)

Type and number of outlets (receptacles): • [Ungrounded - minimal](#)

Circuit interrupters: Ground Fault (GFCI) & Arc Fault (AFCI): • [GFCI - panel](#) • No AFCI

Recommendations

RECOMMENDATIONS \ General

8. Condition: • Property due for complete rewire upon possession.

Location: Throughout

Task: Replace

Time: Immediate

Cost: \$20,000

HEATING

Report No. 4385, v.3

76 Pearson Avenue, Toronto, ON October 23, 2025

SUMMARY

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

REFERENCE

Description

Heating system type: • [Furnace](#)

Fuel/energy source: • [Gas](#)

Heat distribution: • [Ducts and registers](#)

Approximate capacity: • [80,000 BTU/hr](#)

Efficiency: • [High-efficiency](#)

Combustion air source: • Interior of building

Approximate age: • [3 years](#)

Main fuel shut off at: • Meter

Failure probability: • [Low](#)

Air filter: • Disposable

Auxiliary heat: • Heat pump.

Fireplace/stove:

• Decorative only



15.

Chimney/vent:

• [Masonry](#)

For water heater only.

HEATING

Report No. 4385, v.3

76 Pearson Avenue, Toronto, ON October 23, 2025

SUMMARY

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

REFERENCE



16.

- High temperature plastic
For furnace only.
- Sidewall venting
For water heater only.

Chimney liner: • [Metal](#)

Humidifier: • None

Limitations

Heat loss calculations: • Not done as part of a building inspection

Recommendations

FURNACE \ Ducts, registers and grilles

9. Condition: • Some asbestos present at ducting, remove if necessary to disturb.

Location: Throughout

Task: Remove

Time: If necessary

Cost: Consult Contractor For Cost

HEATING

Report No. 4385, v.3

76 Pearson Avenue, Toronto, ON October 23, 2025

SUMMARY

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

REFERENCE



17.

HEATING CONTROL \ Thermostat

10. Condition: • Thermostat poorly configured.

Location: First Floor

Task: Improve

Time: Discretionary

Cost: Minor

COOLING & HEAT PUMP

Report No. 4385, v.3

76 Pearson Avenue, Toronto, ON October 23, 2025

SUMMARY

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

REFERENCE

Description

Air conditioning type: • [Air cooled](#)

Cooling capacity: • [24,000 BTU/hr](#)

Compressor approximate age: • 16 years

Failure probability: • [Medium](#)

Limitations

Inspection limited/prevented by:

- Low outdoor temperature
- System sound checked only.

Heat gain calculations: • Not done as part of a building inspection

Recommendations

AIR CONDITIONING \ Thermostat

11. Condition: • See HEATING.

INSULATION AND VENTILATION

Report No. 4385, v.3

76 Pearson Avenue, Toronto, ON October 23, 2025

SUMMARY

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

REFERENCE

Description

Attic/roof insulation material: • Not determined

Attic/roof insulation amount/value: • Not determined

Attic/roof ventilation: • [Roof vent](#)

Wall insulation amount/value: • Spot checked only • [None found](#)

Foundation wall insulation amount/value: • None

Limitations

Inspection limited/prevented by lack of access to:

- Roof space

Typical for this roofline.

Recommendations

RECOMMENDATIONS \ Overview

12. Condition: • Increased insulation is an improvement and not an essential repair.

Description

Water supply source (based on observed evidence): • Public

Service piping into building:

• [Copper](#)

3/4 inch

Supply piping in building: • [Copper](#)

Main water shut off valve at the:

• South

• West

• Basement



18.

Water flow and pressure: • Good

Water heater type: • [Conventional](#) • Tank • Rental

Water heater fuel/energy source: • [Gas](#)

Water heater tank capacity: • 151 liters

Water heater approximate age: • 12 years

Water heater failure probability: • [Medium](#)


Waste and vent piping in building: • [ABS plastic](#) • [Cast iron](#)

Pumps: • No sump present

Floor drain location: • Near laundry area

Backwater valve:

- Present

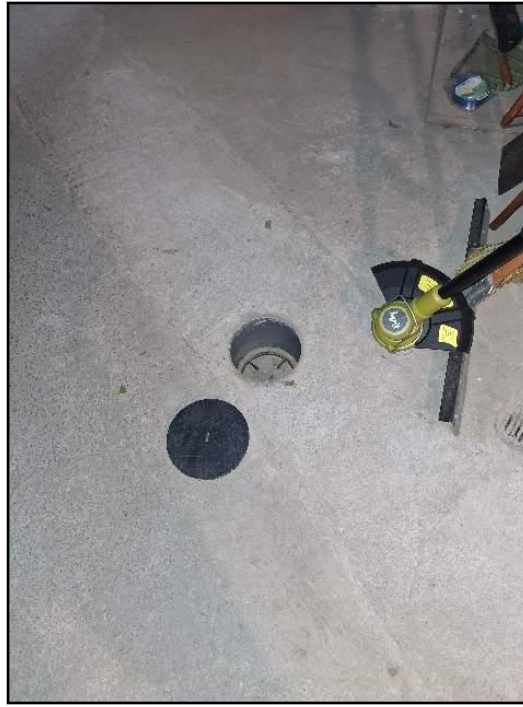**19.**

Limitations


Items excluded from a building inspection: • Concealed plumbing

Recommendations

RECOMMENDATIONS \ Overview

13. Condition: • Fixtures dated and due for updating.

Location: Various Throughout

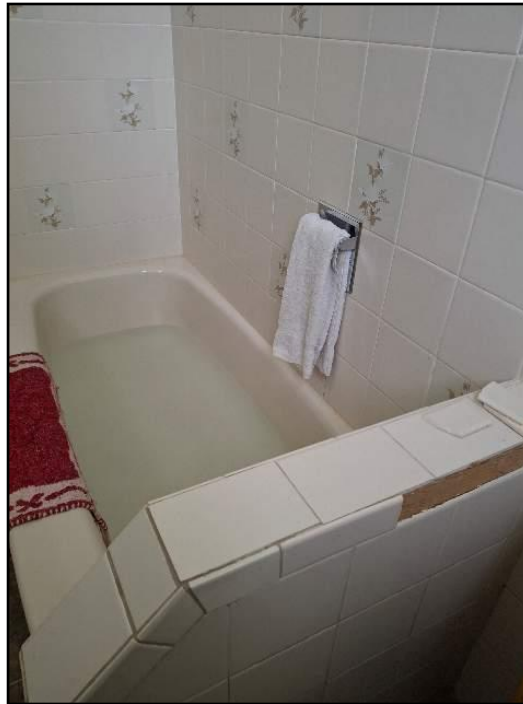

20.

SUPPLY PLUMBING \ Water supply piping in building

14. Condition: • [Rust](#)

Remove unused humidifier shut off near furnace.

Location: East Basement

Task: Remove

Time: Unpredictable

Cost: Minor



21.

WASTE PLUMBING \ Drain piping - installation

15. Condition: • Could not determine if backflow valve is positioned to protect drains at basement.

Location: Basement

Task: Further evaluation



22.

Description

Major floor finishes: • [Carpet](#) • [Hardwood](#) • [Resilient](#)

Major wall finishes: • [Plaster/drywall](#) • [Paneling](#)

Major ceiling finishes: • [Plaster/drywall](#) • [Stucco/texture/stipple](#)

Windows: • [Single/double hung](#) • [Sliders](#) • [Awning](#)

Glazing: • [Single](#) • [Primary plus storm](#)

Exterior doors - type/material: • Hinged • [Wood](#)

Party wall: • [Masonry](#)

Limitations

Not included as part of a building inspection: • Appliances

Percent of foundation not visible: • 10 %

Recommendations

RECOMMENDATIONS \ Overview

16. **Condition:** • Finishes dated and due for updating.

WINDOWS AND DOORS \ General notes

17. **Condition:** • Original lower quality units in use.

Location: Various

Task: Replace

Time: Discretionary

Cost: Consult Contractor For Cost



23.

BASEMENT \ Wet basements - corrective action noted

18. Condition: • [Drainage membrane](#)

Interior drainage membrane present at north basement (addition only). Recommend installation at balance of basement prior to finishing.

Location: Basement

Task: Protect

Time: Before finishing basement

Cost: Consult Contractor For Cost



24. Addition



25. Balance of basment

END OF REPORT

The links below connect you to a series of documents that will help you understand your home and how it works. These are in addition to links attached to specific items in the report.

Click on any link to read about that system.

» 01. ROOFING, FLASHINGS AND CHIMNEYS

» 02. EXTERIOR

» 03. STRUCTURE

» 04. ELECTRICAL

» 05. HEATING

» 06. COOLING/HEAT PUMPS

» 07. INSULATION

» 08. PLUMBING

» 09. INTERIOR

» 10. APPLIANCES

» 11. LIFE CYCLES AND COSTS

» 12. SUPPLEMENTARY

Asbestos

Radon

Urea Formaldehyde Foam Insulation (UFFI)

Lead

Carbon Monoxide

Mold

Household Pests

Termites and Carpenter Ants

» 13. HOME SET-UP AND MAINTENANCE

» 14. MORE ABOUT HOME INSPECTIONS