



# Your Inspection Report

132 Indian Road  
Toronto, ON

**PREPARED FOR:**

KIM KEHOE  
LISTING AGENT

**INSPECTION DATE:**

Wednesday, April 19, 2017

**PREPARED BY:**

Scott Aitken

Aitken Home Inspections  
49 Riverdale Ave  
Toronto, ON m4k1c2

416 407-4663  
scottaitken@live.ca

April 19, 2017

Dear Kim Kehoe and Listing Agent,

RE: Report No. 2149  
132 Indian Road  
Toronto, ON

Thanks very much for choosing us to perform your home inspection. The inspection itself and the attached report comply with the requirements of the Standards of Practice of our national Association. This document defines the scope of a home inspection.

Clients sometimes assume that a home inspection will include many things that are beyond the scope. We encourage you to read the Standards of Practice so that you clearly understand what things are included in the home inspection and report.

The report has been prepared for the exclusive use of our client. No use by third parties is intended. We will not be responsible to any parties for the contents of the report, other than the party named herein .

The report is effectively a snapshot of the house, recording the conditions on a given date and time. Home inspectors cannot predict future behavior, and as such, we cannot be responsible for things that occur after the inspection. If conditions change, we are available to revisit the property and update our report.

The report itself is copyrighted, and may not be used in whole or in part without our express written permission.

Again, thanks very much for choosing us to perform your home inspection.

Sincerely,

Scott Aitken  
on behalf of  
Aitken Home Inspections

Aitken Home Inspections  
49 Riverdale Ave  
Toronto, ON m4k1c2  
416 407-4663

scottaitken@live.ca

# AGREEMENT

Report No. 2149

132 Indian Road, Toronto, ON April 19, 2017

## PARTIES TO THE AGREEMENT

### **Company**

Aitken Home Inspections  
49 Riverdale Ave  
Toronto, ON m4k1c2

### **Client**

Kim Kehoe

### **Client**

Listing Agent

This is an agreement between Kim Kehoe, Listing Agent and Aitken Home Inspections.

**THIS CONTRACT LIMITS THE LIABILITY OF THE HOME INSPECTION COMPANY.  
PLEASE READ CAREFULLY BEFORE SIGNING.**

In addition to the limitations in the Standards of Practice, the Inspection of this property is subject to the Limitations and Conditions set out in this Agreement. The Inspection is performed in accordance with the Standards of Practice of our national association.

## LIMITATIONS AND CONDITIONS OF THE HOME INSPECTION

There are limitations to the scope of this Inspection. It provides a general overview of the more obvious repairs that may be needed. It is not intended to be an exhaustive list. The ultimate decision of what to repair or replace is yours. One homeowner may decide that certain conditions require repair or replacement, while another will not.

### 1) THE INSPECTION IS NOT TECHNICALLY EXHAUSTIVE.

The Home Inspection provides you with a basic overview of the condition of the property. Because your Home Inspector has only a limited amount of time to go through the property, the Inspection is not technically exhaustive.

Some conditions noted, such as foundation cracks or other signs of settling in a house, may either be cosmetic or may indicate a potential problem that is beyond the scope of the Home Inspection.

If you are concerned about any conditions noted in the Home Inspection Report, we strongly recommend that you consult a qualified Licensed Contractor or Consulting Engineer. These professionals can provide a more detailed analysis of any conditions noted in the Report at an additional cost

### 2) THE INSPECTION IS AN OPINION OF THE PRESENT CONDITION OF THE VISIBLE COMPONENTS.

The Home Inspector's Report is an opinion of the present condition of the property. It is based on a visual examination of the readily accessible features of the building.

A Home Inspection does not include identifying defects that are hidden behind walls, floors or ceilings. This includes wiring, heating, cooling, structure, plumbing and insulation that are hidden or inaccessible.

Some intermittent problems may not be obvious on a Home Inspection because they only happen under certain circumstances. As an example, your Home Inspector may not discover leaks that occur only during certain weather conditions or when a specific tap or appliance is being used in everyday life.

Home Inspectors will not find conditions that may only be visible when storage or furniture is moved. They do not

# AGREEMENT

132 Indian Road, Toronto, ON April 19, 2017

remove wall coverings (including wallpaper) or lift flooring (including carpet) or move storage to look underneath or behind.

### 3) THE INSPECTION DOES NOT INCLUDE HAZARDOUS MATERIALS.

This includes building materials that are now suspected of posing a risk to health such as phenol-formaldehyde and urea-formaldehyde based insulation, fiberglass insulation and vermiculite insulation. The Inspector does not identify asbestos roofing, siding, wall, ceiling or floor finishes, insulation or fireproofing. We do not look for lead or other toxic metals in such things as pipes, paint or window coverings.

The Inspection does not deal with environmental hazards such as the past use of insecticides, fungicides, herbicides or pesticides. The Home Inspector does not look for, or comment on, the past use of chemical termite treatments in or around the property.

### 4) WE DO NOT COMMENT ON THE QUALITY OF AIR IN A BUILDING.

The Inspector does not try to determine if there are irritants, pollutants, contaminants, or toxic materials in or around the building.

The Inspection does not include spores, fungus, mold or mildew that may be present. You should note that whenever there is water damage noted in the report, there is a possibility that mold or mildew may be present, unseen behind a wall, floor or ceiling.

If anyone in your home suffers from allergies or heightened sensitivity to quality of air, we strongly recommend that you consult a qualified Environmental Consultant who can test for toxic materials, mold and allergens at additional cost.

### 5) WE DON'T LOOK FOR BURIED TANKS.

Your Home Inspector does not look for and is not responsible for fuel oil, septic or gasoline tanks that may be buried on the property. If the building had its heating system converted from oil, there will always be the possibility that a tank may remain buried on the property.

If fuel oil or other storage tanks remain on the property, you may be responsible for their removal and the safe disposal of any contaminated soil. If you suspect there is a buried tank, we strongly recommend that you retain a qualified Environmental Consultant to determine whether this is a potential problem.

### 6) TIME TO INVESTIGATE

We will have no liability for any claim or complaint if conditions have been disturbed, altered, repaired, replaced or otherwise changed before we have had a reasonable period of time to investigate.

### 7) REPORT IS FOR OUR CLIENT ONLY

The inspection report is for the exclusive use of the client named herein. No use of the information by any other party is intended.

# AGREEMENT

132 Indian Road, Toronto, ON April 19, 2017

Report No. 2149

## 8) CANCELLATION FEE

If the inspection is cancelled within 24 hours of the appointment time, a cancellation fee of 50% of the inspection fee will apply.

## 9) NOT A GUARANTEE, WARRANTY OR INSURANCE POLICY.

The inspection is not a guarantee, warranty or an insurance policy with regard to the fitness of the property.

## 10) LIMIT OF LIABILITY / LIQUIDATED DAMAGES

The liability of the Home Inspector and the Home Inspection Company arising out of this Inspection and Report, for any cause of action whatsoever, whether in contract or in negligence, is limited to a refund of the fees that you have been charged for this inspection.

**I, Kim Kehoe (Signature) \_\_\_\_\_, (Date) \_\_\_\_\_, have read, understood and accepted the terms of this agreement.**

**I, Listing Agent (Signature) \_\_\_\_\_, (Date) \_\_\_\_\_, have read, understood and accepted the terms of this agreement.**

# SUMMARY

132 Indian Road, Toronto, ON April 19, 2017

SUMMARY

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

REFERENCE

**Note:** For the purpose of this report the building is considered to be facing **East**.

This Summary outlines potentially significant issues from a cost or safety standpoint. This section is provided as a courtesy and cannot be considered a substitute for reading the entire report. Please read the complete document.

[Priority Maintenance Items](#)

## Structure

### WALLS \ Solid masonry walls

**Condition:** • [Cracked](#)

Large tree at s/w of property is creating movement of west structure, while not urgent, tree will likely need to be removed. Masonry repairs would be minor in cost. Contact arborist re cost of tree removal.

**Implication(s):** Weakened structure

**Location:** West Exterior Wall

**Task:** Further evaluate

**Time:** Unpredictable

## Electrical

### DISTRIBUTION SYSTEM \ Knob-and-tube

**Condition:** • [Outdated](#)

Knob and tube visible at dining room and switches at base of stairs only. Disconnect to determine if more is present.

**Implication(s):** Nuisance | Potential problem when obtaining home insurance

**Location:** Various

**Task:** Replace

**Time:** Immediate

**Cost:** \$2,000

This concludes the Summary section.

The remainder of the report describes each of the home's systems and also details any recommendations we have for improvements. Limitations that restricted our inspection are included as well.

The suggested time frames for completing recommendations are based on the limited information available during a pre-purchase home inspection. These may have to be adjusted based on the findings of specialists.

[Home Improvement - ballpark costs](#)

# ROOFING

Report No. 2149

132 Indian Road, Toronto, ON April 19, 2017

SUMMARY

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

REFERENCE

## Description

### Sloped roofing material:

- [Asphalt shingles](#)



1. *Asphalt shingles*

### Flat roofing material:

- [Modified bitumen](#)

# ROOFING

132 Indian Road, Toronto, ON April 19, 2017

SUMMARY

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

REFERENCE



2. Modified bitumen

- [Metal](#)

Probability of leakage: • Low

## Limitations

Inspection performed: • By walking on roof

## Recommendations

### RECOMMENDATIONS \ Overview

1. **Condition:** • No roofing recommendations are offered as a result of this inspection. Newer roof surfaces throughout, all in good condition.



# EXTERIOR

132 Indian Road, Toronto, ON April 19, 2017

SUMMARY

ROOFING

**EXTERIOR**

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

REFERENCE

## Description

**Gutter & downspout material:** • [Aluminum](#) • [Plastic](#)

**Downspout discharge:** • [Above grade](#)

**Lot slope:** • [Flat](#)

**Wall surfaces - masonry:** • [Brick](#)

**Wall surfaces and trim:** • [Metal siding](#)

**Soffit and fascia:** • [Wood](#)

**Driveway:** • Concrete • Interlocking brick

**Walkway:** • Interlocking brick

**Garage:** • Wood Frame • Detached

## Recommendations

### **ROOF DRAINAGE \ Downspouts**

**2. Condition:** • [Downspouts discharging below grade](#)

Disconnect downspouts and route well away from foundation.


**Implication(s):** Chance of water damage to contents, finishes and/or structure

**Location:** Throughout Exterior

**Task:** Improve

**Time:** Immediate

**Cost:** Minor

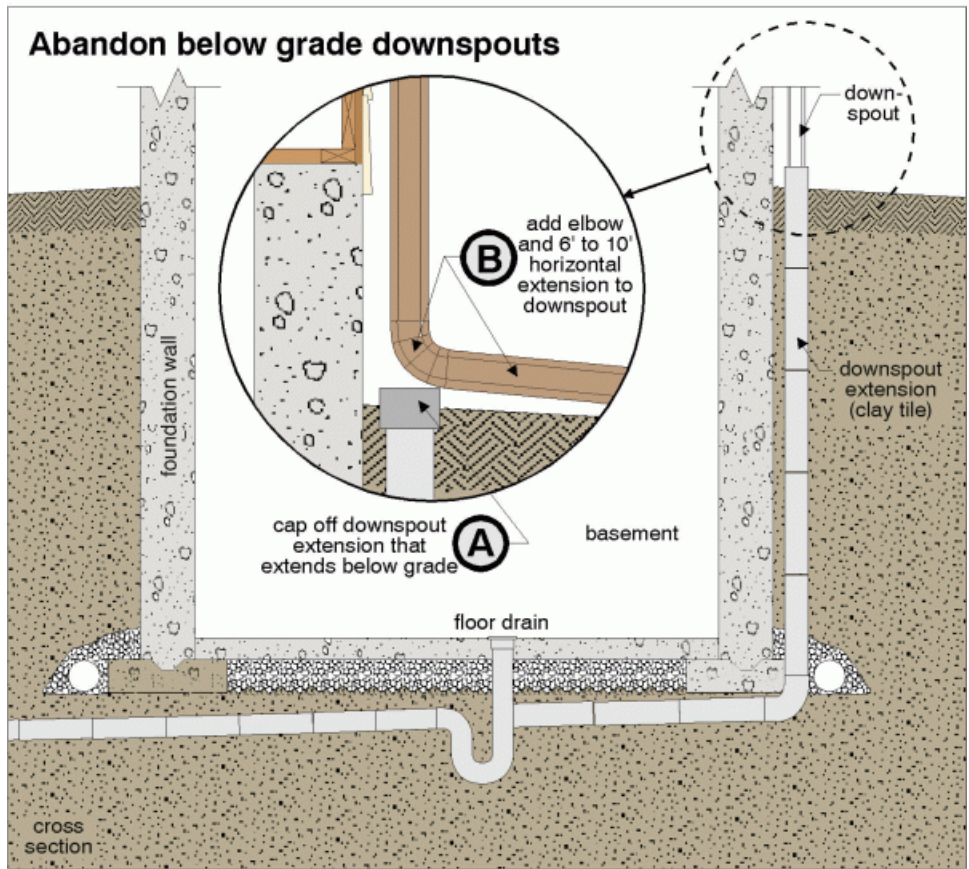

## WALLS \ Brick, stone and concrete

**3. Condition:** • Typical minor cracks, not structurally significant.

Typical tuckpointing needed, not urgent.

**Location:** Various Exterior Wall

**Task:** Repair

**Time:** Discretionary

**Cost:** Minor

# EXTERIOR

132 Indian Road, Toronto, ON April 19, 2017

SUMMARY

ROOFING

**EXTERIOR**

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

REFERENCE



3. Cracked

## GARAGE \ General

4. Condition: • Typical low quality structure

Implication(s): Chance of water entering building | Chance of structural movement | Chance of pests entering building | Physical injury



4. Typical low quality structure

## Description

**Configuration:** • [Basement](#) • [Crawl space](#)

**Foundation material:** • [Stone](#)

**Floor construction:** • [Joists](#)

**Exterior wall construction:** • [Masonry](#)

**Roof and ceiling framing:** • Rafters/ceiling joists • [Plank sheathing](#)

## Limitations

**Attic/roof space:** • No access

**Percent of foundation not visible:** • 25 %

## Recommendations

### WALLS \ Solid masonry walls

#### **5. Condition:** • [Cracked](#)

Large tree at s/w of property is creating movement of west structure, while not urgent, tree will likely need to be removed. Masonry repairs would be minor in cost. Contact arborist re cost of tree removal.

**Implication(s):** Weakened structure

**Location:** West Exterior Wall

**Task:** Further evaluate

**Time:** Unpredictable



5. Tree too close



6. Cracked structure

## Description

**Service entrance cable and location:** • [Overhead copper](#)

**Service size:** • [200 Amps \(240 Volts\)](#)

**Main disconnect/service box rating:** • [200 Amps](#)

**Main disconnect/service box type and location:** • [Breakers - basement](#)

**System grounding material and type:** • [Copper - water pipe](#)

**Distribution panel rating:** • [200 Amps](#)

**Distribution panel type and location:** • [Breakers - basement](#)

**Auxiliary panel (subpanel) type and location:** • Breakers third floor

**Distribution wire material and type:** • [Copper - non-metallic sheathed](#) • [Copper - knob and tube](#)

**Type and number of outlets (receptacles):** • [Grounded - minimal](#)

**Circuit interrupters: Ground Fault (GFCI) & Arc Fault (AFCI):** • [GFCI - bathroom](#) • [GFCI - panel](#)

**Smoke detectors:** • [Present](#)

**Carbon monoxide (CO) detectors:** • Present

## Limitations

**Panel covers:**

- Not safe to remove

Third floor panel cover painted in place and not removed.

## Recommendations

**DISTRIBUTION SYSTEM \ Knob-and-tube**

**6. Condition:** • [Outdated](#)

Knob and tube visible at dining room and switches at base of stairs only. Disconnect to determine if more is present.

**Implication(s):** Nuisance | Potential problem when obtaining home insurance

**Location:** Various

**Task:** Replace

**Time:** Immediate

**Cost:** \$2,000



7. Outdated



8. Outdated

### **DISTRIBUTION SYSTEM \ Switches**


**7. Condition:** • Poor location of switches.  
Relocate entrance switches closer to front door.

**Location:** First Floor Hallway

**Task:** Improve

**Time:** Discretionary

**Cost:** \$1000

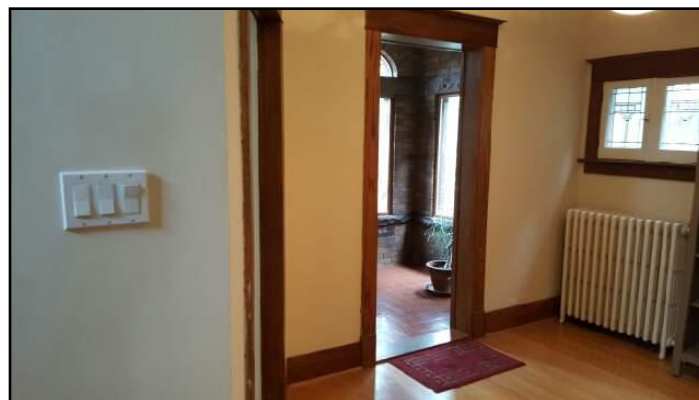

9. Poor location of switches.


**8. Condition:** • [Location poor \(near Bath Tub or Shower Stall\)](#)

Move electrical further from shower stall.

**Implication(s):** Electric shock

**Location:** Second Floor Ensuite Bathroom

**Task:** Improve  
**Time:** Immediate  
**Cost:** Minor

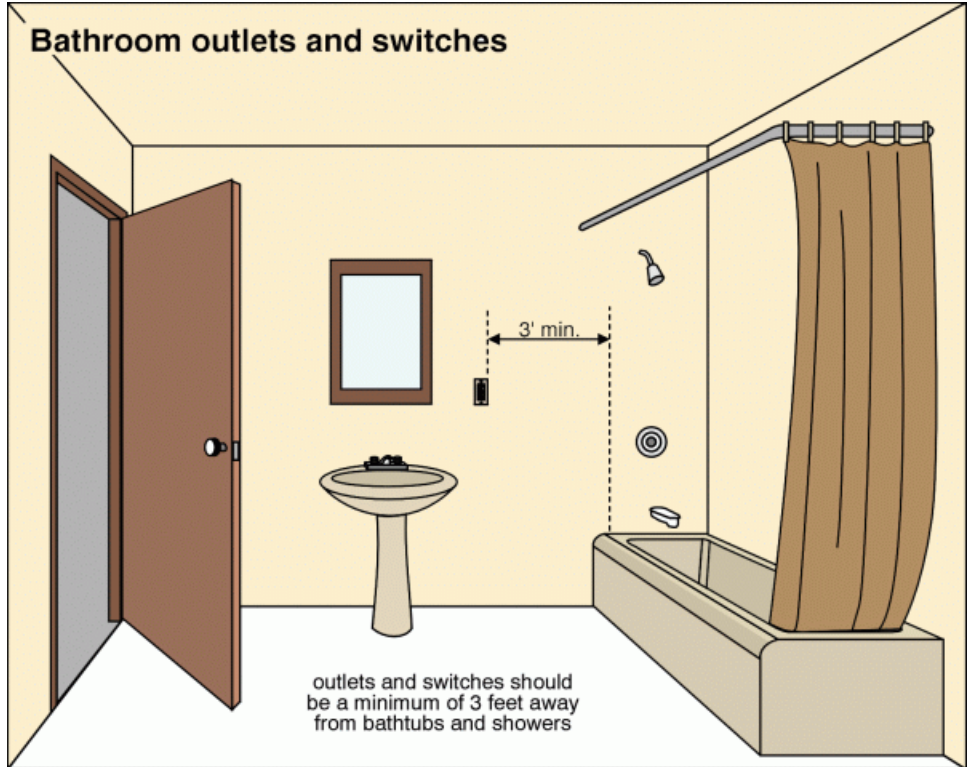

10. Location poor (near Bath Tub or Shower Stall)

## Description

**System type:** • [Boiler](#)

**Fuel/energy source:** • [Gas](#)

**Heat distribution:** • [Radiators](#)

**Approximate capacity:** • [110,000 BTU/hr](#)

**Efficiency:** • [High-efficiency](#)

**Approximate age:** • [7 years](#)

**Main fuel shut off at:** • Meter

**Failure probability:** • [Low](#)

**Auxiliary heat:** • [Electric baseboard heater](#)

**Fireplace/stove:**

• Coal-burning fireplace - not in service

Chimney in good condition if restoration or conversion to gas/wood desired.



11. Coal-burning fireplace - not in service

**Combustion air source:** • Outside



# HEATING

Report No. 2149

132 Indian Road, Toronto, ON April 19, 2017

SUMMARY

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

REFERENCE

## Limitations

**Heat loss calculations:** • Not done as part of a building inspection

## Recommendations

### RECOMMENDATIONS \ Overview

**9. Condition:** • No heating recommendations are offered as a result of this inspection.

# COOLING & HEAT PUMP

Report No. 2149

132 Indian Road, Toronto, ON April 19, 2017

SUMMARY

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

REFERENCE

## Description

**Air conditioning type:** • None present

- SUMMARY
  - ROOFING
  - EXTERIOR
  - STRUCTURE
  - ELECTRICAL
  - HEATING
  - COOLING
  - INSULATION**
  - PLUMBING
  - INTERIOR
- REFERENCE

## Description

**Attic/roof insulation material:** • Not determined  
**Attic/roof insulation amount/value:** • Not determined  
**Attic/roof ventilation:** • [Ridge vent](#)  
**Wall insulation amount/value:** • Spot checked only • [None found](#)  
**Foundation wall insulation amount/value:** • [None found](#)

## Limitations

**Inspection prevented by no access to:** • Roof space • Crawl space

## Recommendations

**RECOMMENDATIONS \ Overview**

**10. Condition:** • Increased insulation is an improvement and not an essential repair.

## Description

**Water supply source:** • Public

**Service piping into building:** • [Not visible](#)

**Supply piping in building:** • [Copper](#)

**Main water shut off valve at the:** • East • Basement

**Water flow and pressure:** • [Functional](#)

**Water heater type:** • [Conventional](#)

**Water heater fuel/energy source:** • [Gas](#)

**Tank capacity:** • 151 liters

**Water heater approximate age:** • 17 years

**Water heater failure probability:** • [High](#)

**Waste and vent piping in building:** • [ABS plastic](#) • [Copper](#) • [Cast Iron](#)

**Floor drain location:** • Near laundry area • Near water heater

**Backwater valve:** • Not present

## Limitations

**Items excluded from a building inspection:** • Concealed plumbing

## Recommendations

### WATER HEATER \ Life expectancy

**11. Condition:** • [Near end of life expectancy](#)

**Implication(s):** No hot water

**Location:** Basement

**Task:** Replace

**Time:** Unpredictable

**Cost:** Can be rented at minimal cost

### WASTE PLUMBING \ Drain piping - performance

**12. Condition:** • [Rust](#)


Replace original cast iron waste piping if renovating.

**Implication(s):** Sewage entering the building

**Location:** Throughout

**Task:** Replace

**Time:** If renovating

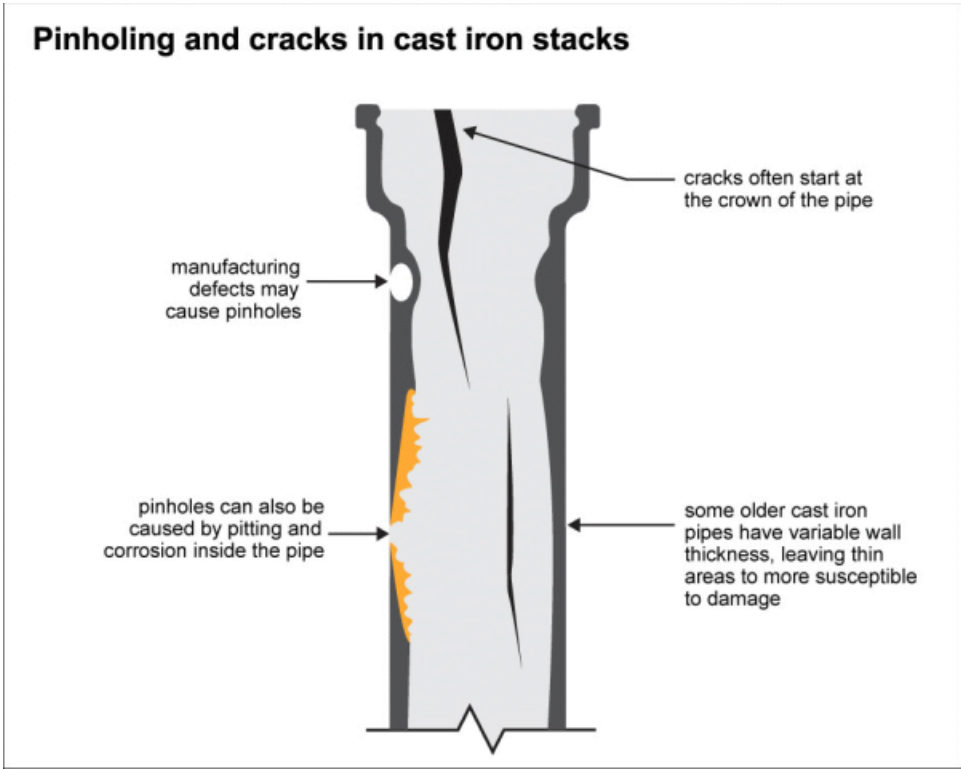

### WASTE PLUMBING \ Traps - installation

**13. Condition:** • [Not visible](#)

Trap not visible at second floor sink, add if odour develops.

**Implication(s):** Difficult access

**Location:** Second Floor Ensuite Bathroom

**Task:** Further evaluation

## Description

Major floor finishes: • [Hardwood](#) • [Concrete](#) • Tile

Major wall finishes: • [Plaster/drywall](#)

Major ceiling finishes: • [Plaster/drywall](#)

Windows: • [Fixed](#) • [Single/double hung](#) • [Sliders](#) • [Casement](#) • [Skylight](#)

Glazing: • [Single](#) • [Double](#)

Exterior doors - type/material: • Hinged • [Metal](#)

Evidence of basement leakage: • None

## Limitations

Inspection limited/prevented by: • Storage/furnishings • New finishes/paint

Not included as part of a building inspection: • Appliances

Percent of foundation not visible: • 25 %

## Recommendations

### STAIRS \ Guardrails

14. **Condition:** • Railing not child safe.

**Location:** Third Floor Staircase

**Task:** Improve

**Time:** If necessary



12.

END OF REPORT

The links below connect you to a series of documents that will help you understand your home and how it works. These are in addition to links attached to specific items in the report.

Click on any link to read about that system.

» 01. ROOFING, FLASHINGS AND CHIMNEYS

» 02. EXTERIOR

» 03. STRUCTURE

» 04. ELECTRICAL

» 05. HEATING

» 06. COOLING/HEAT PUMPS

» 07. INSULATION

» 08. PLUMBING

» 09. INTERIOR

» 10. APPLIANCES

» 11. LIFE CYCLES AND COSTS

» 12. SUPPLEMENTARY

Asbestos

Radon

Urea Formaldehyde Foam Insulation (UFFI)

Lead

Carbon Monoxide

Mold

Household Pests

Termites and Carpenter Ants

» 13. HOME SET-UP AND MAINTENANCE

» 14. MORE ABOUT HOME INSPECTIONS